


Illustrated on model 209.3

- 1 Glove compartment
 2 Screw
 3 Screw
 4 Screw
 5 Screw
 6 Notch
 7 Lower section of dashboard

E13/2 Glove compartment illumination with switch

X39/45 Walkman separation point

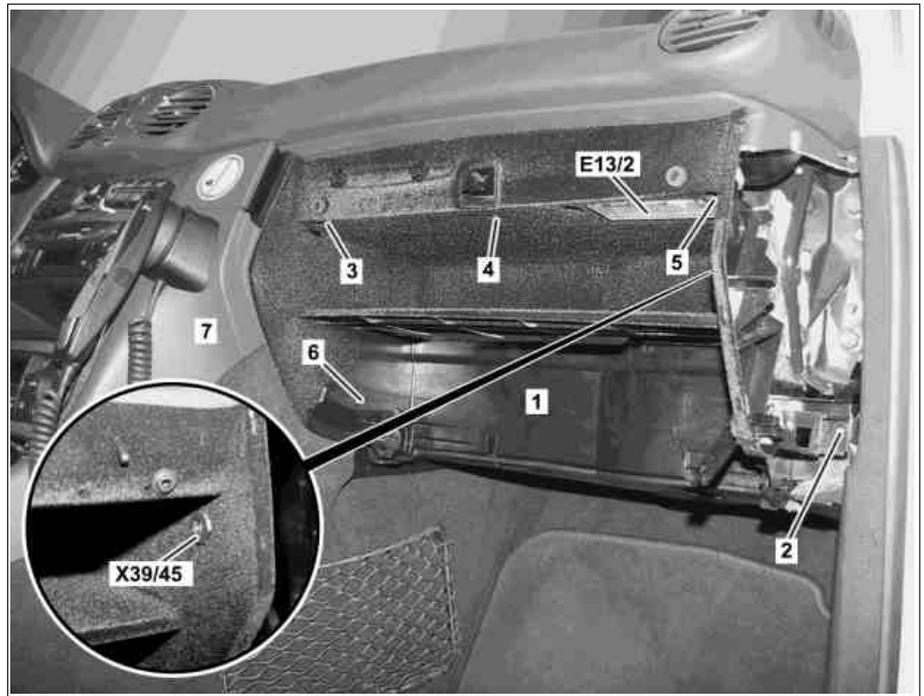

P68.10-3905-06

Modification notes

23.1.08	Tightening sequence for glove box added		
---------	---	--	--

 	Remove/install		
1	Remove cover below right dashboard		AR68.10-P-1520P
2	Remove glove compartment lid		AR68.10-P-1200Q
3	Remove CD changer	On vehicles with code (819) CD changer.	AR82.64-P-7507P
4	Remove walkman separation point (X39/45)	On vehicles with code (523) Audio 20 with CD changer or with Code (525) MB Audio 50 APS radio or with Code (527) COMAND APS with single drive (with navigation) or with Code (529) HIGH Class Japan or with Code (530) COMAND APS USA (with navigation) or with Code (535) Audio 20 CD radio, USA.	AR68.10-P-1400-01CW
5	Unscrew bolt (2)		
6	Unscrew screws (3, 4, 5)		
7	Press in catch (6)		
8	Remove glove box (1) out of instrument panel lower section (7) at side	 Installation: First install glove compartment (1) in guide rail	
9	Disconnect electrical connector from glove compartment illumination with switch (E13/2)		
10	Disconnect electrical connector for ATA glove compartment switch	Only on model 209.4 with code (551) Anti-theft alarm system (ATA).	
11	Remove electrical connector from glove compartment CL solenoid.	Only on model 209.4.	
12	Remove glove compartment (1)		
13	Install in the reverse order		